GMC Motorhome Parking Brake Deficiencies and Improvements



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Objective

- Why the OEM park brake system was possibly designed the way it was ?
- Let us look at the OEM park brake assembly and its various components

 Discuss each of the components and how they might be improved upon

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?



Lowes / Home Depot type Parking Brake

The "Good Samaritan" from Ohio sent this photo !

HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?



"Favorite Wife" Wheel Chock !

\$14.95 at Camping World and \$16.95 " With Rope Handles"

HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Let's look back to the early to mid 70' s and ponder the philosophy of the North American auto builders.

In general ; build it as economically as possible, utilize as many parts as possible from existing inventories and satisfy the rules and conventions of the Federal DOT and the standards of the SAE.

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Although safety was important and safety improvements were constantly being implemented, they were always done with an acute eye to economics.

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

□ If the GMC Motorhome were to have the very best of everything that was available to the automotive industry when it was being built , GM would have probably have canned it in '75 or '76 instead of 1978. The overall cost would been prohibitive .

Corrosion proof components were simply too expensive or not available at all . Also the automotive market does rely on a significant portion of their revenues supplying replacement parts.

We GMC'ers are in a unique position in that we own and drive a vehicle that statistically is three lifetimes old, we look for the best products available for replacements and quite often if there is a permanent fix, we're all for it as long as it is a good value. Why the OEM Park Brake System Was Possibly Designed the Way It Was ?

Warranties and competition back then wasn't what they are today. The pursuit of excellence in design and materials did not bode well for the bottom line of the " Big Three"

With regards to our parking brake, it may have been designed on a Friday afternoon or Monday morning.

However, rumor has it that the handle location was chosen by a hung-over engineer working overtime on New Years day in 1972.

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Why the OEM Park Brake System Was Possibly Designed the Way It Was ?

BOTTOM LINE :

Our parking brake system is not of sub standard materials or design . In fact it functioned well when it was new. If all new OEM components were installed and adjusted properly it would be quite acceptable even now. Although newer and higher tech equipment exists today at an affordable cost.

From what information I have been able to gather in the last 5 years, I have basically concluded that the OEM parking brake for the GMC currently suffers from the following deficiencies:

1/ Sufficient force could not be applied to 4 rear brake shoe sets to ensure a positive braking effect on say a 6 to 10 percent grade, forward or backward.

2/ Due to the ergonomics of the parking brake handle, or lack thereof it becomes increasingly difficult for some of us to generate the force required to"set" the parking brake properly so it can do its

job. 25/05/2011

3/ Due to insufficient force being applied to the 4 rear shoe sets, many GMC'ers complained that they "drove away" with the parking brake engaged, perhaps their "tell tale" lamp was burned out, or missed! Or the switch failed. This of course leads to all sorts of nasty consequences regarding brake shoes, drums and bearings.

Why the OEM Park Brake System Was Possibly Designed the Way It Was ?

4/ Even though the OEM park brake assembly would meet the requirements of GM and the US DOT in the 70's when the assemblies were new, properly adjusted and "set", it wasn't long before corrosion and old age took their toll on the system.

5/ Because of corrosion issues and accompanying " oxide jacking" inside the spiral "bowden" conduits, the core cables gradually became tighter and tighter and eventually seized inside the conduits. This of course caused the brakes not to release and caused all sorts of headaches for the coach operator.

Why the OEM park brake system was possibly designed the way it was? 6/ Since the cost of replacing the original **OEM park brake system with a new OEM** system is approx. \$300.00, many GMC'ers concluded " why bother ? ", in 3 or 4 years we'll have the same problem with corrosion and huge friction issues and have a park brake system that we can't trust. Also the warranty has long expired, typically lasting 90 days to 6 months from date of purchase.

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Let us look at the OEM park brake assembly and its various components □Brake drums and shoes Parkbrake levers and struts □Shoe bearing pads □Auto adjusters Backing plate spring hardware □ Backing plate wheel cylinders

OEM Park Brake Assembly and Its Various Components

Brake Shoes : Two different types and two different widths as well as assorted friction materials.



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ? Photo courtesy of Bill Brown

Backing plate wear pads:

Over time these shoe wear pads take quite a beating, when installing new shoes carefully clean and inspect these pads, using a zirconia flap disc one can generally buff out the worst of the wear damage in severe cases the pads have been built up using brazing rod and buffed flat after, due to a new backing plate not being readily available. Ensure these pads are sparingly lubricated with never – seize or a similar compound.



Blank backing plate

- Disregarding friction materials, there were two basic shoe configurations. The 1973 and '74 GMC used a shoe set originally designed for the 1969 Pontiac Bonneville S.W., commonly referred to as a #272, The park brake lever hole was very high up on the shoe web compared to the later and current shoe used on the 1975 thru '78 GMC's ; the #462 shoe was designed for the 1972 and '73 Pontiac S.W.
- GM essentially recalled all the 1973, '74 and a limited number of '75 rear brake assemblies and reissued completely loaded backing plates of the newer Pontiac vintage, ie. The #462 shoe set.

HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Current shoe type #462 (Low hole)

Note : bottom of park brake lever hole in line with top of piston pushrod notch





HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Current shoe type #462 (Low Hole)

Note how tang on brake shoe aligns correctly with the notch in the park brake lever and that the horizontal strut is centered and level. This is a correct configuration



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

• This is a pre 1975 shoe ie. #272 with a post 1975 park brake ever, note the severe misalignment due to the high hole on the #272 shoe . This usually occurs when a new owner doesn't realize that GM recalled these assemblies in 1975.



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

This is a post 1975 shoe ie. #462 with a pre 1975 park brake lever, again severe misalignment due to the lower hole on the shoe and a lever that's too long. This scenario would be very rare due to the recall on the old park brake levers and the inability to purchase new ones.



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Brake Shoe / Park Brake Lever Mismatch

 The pre '75 shoe and the current park brake lever is by far the most common mismatch. This type of mismatch will cause severe binding between the cross strut, the park brake lever and shoe. This will impair parking brake operation and to a lesser extent the operation of the service brake as well

Park Brake Strut:



Over time the cross strut will wear at both ends leading to excessive play in relation to the PB lever and brake shoe. This will translate to lost motion in the PB cable system. With the total handle travel distance limited to 2.375", lost motion must be kept to a minimum. With the brakes properly adjusted ; the end play of the PB strut should not exceed 1/32", replacement or building up the worn areas in the notches will be necessary if wear is excessive.

Auto Adjusters:



The auto adjusters will work if the coach is backed up with sufficient conviction and the brakes are sharply applied. However the "significant other" will be less than impressed with the rearrangement of the cupboard and fridge contents. THUS: Manual adjustment is strongly advised whenever the brake pedal travel approaches halfway.

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Backing plate spring hardware

 The backing plate springs are normally regarded as passive devices, ie. If they are there and in one piece, then all is well. Even if the springs still have the paint on them, they only have a limited lifetime due to constant cycling and heat. They should be replaced at least on every second shoe change.

Backing plate wheel cylinders



 Check for any signs of fluid leakage, rubber boot damage and excessive wear of cylinder push rods.

 The OEM conduits are of a "spiral bowden" design, essentially a closed flat wire spring with attachment fittings at the ends. The OEM conduit had no outer covering, this is beneficial in that the conduit / cable assembly could dry out after being wetted thus helping to lessen corrosion problems.

 The inner cable or " strand" is a 1 x 19 steel cable , 1/8" diameter. Sometimes galvanized , sometimes not. This resulted in a steel on steel assembly and friction increases mounted quickly as a function of degrees of bends in the cable system and accompanying corrosion.

- Cable pull friction is a function of the following:
- 1/ Materials being used, ie. Steel on steel, galvanized cable being rougher than plain steel.
- 2/ Total number of degrees of bends in the system.
- 3/ Total load (pull force) the cable system has to exert.

Except in very special cases and at the recommendation of the manufacturer, conduit / cable assemblies are never to be lubricated. This will only be a short term fix and due to dirt and metallic particles with accompanying loss of volatiles in the lubricant, friction issues will reappear and be worse than before lubrication.

New metal to metal conduit / cable assembly Vs. plastic lined conduits and galv. steel cables. Polished stainless steel cables with teflon lined conduits will perform approx. 50 to 70 % better than even galv. / plastic





 Braided stainless steel conduits with teflon liners and polished stainless cables are virtually "bullet proof" they will last a life time provided they are not physically crushed and that their loading is limited to approx. 600 lbs., ie. A 3.5 to 1 safety factor.

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

• Front bogie cable guide:





OEM guide is extremely restrictive to the front bogie conduit movement. It should be modified to a similar configuration as seen in the photo on the right or removed completely.

> HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Photo of homemade conduit guide



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

 Brake cable equalizer and adjuster for rear and intermediate axle brake cables. One on each side of the coach, outside the frame rails.

ANODIZED ALUMINUM EQUALIZER / ADJUSTER PULLEY ASSEMBLY



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

- The dual conduit cable equalizer / adjuster turns the rear most cable 180 degrees and allows it to be connected to the front cable via a cable connector.
- After a number of years the cable will take a more or less permanent set in the equalizer and corrosion between the cable and the equalizer and between the cable strands themselves will essentially prevent the equalizer from doing its job of balancing the forces applied to the two joined brake cables.

HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

 To help prevent this problem a number of people have replaced the OEM equalizer with a suitable pulley and yoke assembly. There are a number of folk in the GMC community that sell these pulleys. One pulley possibility is the Stanley garage door pulley, it's about the right diameter. Just seal the small bearing against water and dirt.

 Note the stainless return spring attached to the pulley yoke.



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

 The intermediate cable retract springs avoid having to rely on the individual conduit springs to help pull back the intermediate and brake handle cable, thus ensuring positive release of brake shoe tension when the PB handle is released. Together the two stainless springs apply about 35 lbs. pull back force on the above cables.

One of these pulleys on each side of the coach to replace





HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

Pulley is
Replacement for
the OEM S-hook,
pulley mainly
added for
strength

ANODIZED ALUMINUM " THRU-FRAME" ROUTING PULLEY. (Replacement for OEM Hook) **OEM Cable Hook** Thru - Frame"



 The keyhole slot in the frame is to provide clearance for the union on the intermediate cable. The OEM slot is approx. 3/8" in height, whereas the new slot is 9/16" in height.

25/05/2011



 This union is <u>not</u> to be taken apart. A stainless steel cylinder has been swaged onto the cable inside the union to supplement the strength of the two ¼" Allen set screws.



But all is not lost ! When you buy a new frame from the " Frame Doctor" the enlarged slots are included absolutely free of charge !

HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

 The OEM intermediate cable was supplied in two lengths, to accommodate the 260's and the 230 coaches as well. Presently there is only one length available to the best of my knowledge. If you own a 230 coach be prepared to tie a few knots in the cable to shorten it up by the required 40 inches. However the new stainless steel intermediate cables come in both lengths !

Intermediate Cable union



• OEM equalizer to connect intermediate cable to park brake handle cable



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

 This is the wrong equalizer to use under the coach where the PB handle cable connects to the intermediate cable



HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?

 In the previous slide the equalizer bar is for the dual conduit cables on the side of the coach. With the angles formed by the cable routing, one would have a fixed point equalizer. One can experience differences of 300 to 400 % in pull forces between the two sides of the coach if the cable is old and somewhat corroded.





Will balance left and right pull forces to less than 10 %, a 2 to 3 times improvement over OEM Eq.

HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?



 Due to State and Provincial DOT regulations and civil litigation issues it would appear that we are stuck with the OEM park brake handle and its location forever. I have spent days talking to various state and provincial DOT authorities and the vagueness of their answers was only surpassed by their number of times they requested " please leave a voice message" their general response would make most politicians proud.

 To "set" the parking brake properly and to achieve the most effectiveness, one should observe the following:

1/ Step firmly on the service brake pedal

2/ Attempt to rock the coach slightly ahead or back in "D" or "R" depending whether the coach is descending or ascending a grade.

Don't underestimate the effectiveness of the Bendix duo servo brake system! Make it work for you . It's "all in the technique" as I was reminded by an experienced GMC'er who observed me slamming my coach door.

3/ Apply the park brake and try to move the coach under moderate power. It should not move.

 One should attempt to keep a ¼" adjustment remaining on the PB handle adjustment knob. If less than this amount of travel is remaining, then one should readjust the cables at the equalizers on the side of the coach.

Relating to our original objectives in summary:

1/ The mechanical aspects of the brake drum and shoe assembly must be addressed.

2/ The cables and conduits must operate freely and be free of corrosion.

3/ The correct technique must be used in applying the park brake.

HOW ABOUT A GMC PARKING AND EMERGENCY BRAKE ?